

## Resolved Issues

The following issues are fixed in software update 10.13.909-158:

- User could not configure units of measure for both pounds and bushels in Work Totals
- Display response could become delayed when using AMS applications on combines
- Intermittent issues with harvest documentation yield and speed data in MyJohnDeere Operations Center
- Average yield resetting to zero on legacy combine CommandCenter™ after a key cycle when equipped with a Gen 4 4640 display.
- Work Totals may revert to zero when key cycling the 4640 on a Self-Propelled Forage Harvester (SPFH)
- An application error may occur when switching to or from Bulgarian language
- Display may not increment harvest load totals when returning to a field
- Combines experiencing Gen 4 Application Error while utilizing In Field Data Sharing.
- Work recording status would turn off or flicker causing map coverage gaps on the Universal 4640 Display on a S600 Series Combine with Active Yield. This would result in segments of zero yield in the harvest documentation within Field Analyzer.
- Field and Load Totals stopped incrementing when using variety locator during harvest operation.
- Generation 4 CommandCenter™ did not load ISOTASK.XML files into the Task List in Work Setup.
- Work Totals did not match Work Monitor within Documentation.
- After updating the John Deere 4640 Universal Display to 18-2 software, ATC Raven and ATC Reichardt systems would not allow AutoTrac™ guidance function on Curve, Circle, or Boundary Tracks.
- The Total Applied product did not increment within documentation Work Totals.
- Generation 4 Displays were creating several small work documentation packets every minute and sending them to My Files within the MyJohnDeere Operation Center customer profile.
- Application Error may have occurred when moving 4640 Universal Display between legacy sprayers.
- Look ahead model improvements to resolve Section Control performance complaints on air seeders and other equipment with greater than 2.5 second mechanical delay times.
- Section Control message rate has been increased for sprayers to improve speed of control over the sections. This improvement is primarily for ExactApply™ customers.
- AutoTrac™ Vision RowSense™ calibration values did not save on a cold boot.
- File Server communicated on CAN bus when turned off.
- Application error occurred during planting, causing inability to adjust the planter row cleaners.
- Prescription may not import due to unrecognized special characters
- Intermittent loss of coverage on GreenStar™ Rate Controller

---

## Release Notice

These are Generation 4 OS and AMS Applications software update release notes for the Generation 4 Displays. Release notes can be found on [www.stellarsupport.com](http://www.stellarsupport.com). Note: Your use of the software is governed by the End User License Agreement included with the software.

Copyright © 1996-2019 Deere & Company